

 Printable View	
TSB 15-0142	HARSH OR FIRM 5-4 DOWNSHIFT
Publication Date: September 16, 2015	

FORD: 2015 F-150

ISSUE:

Some 2015 F-150 vehicles may exhibit a harsh or firm 5-4 downshift. The condition usually occurs while coasting with very light pressure on the accelerator between 40-56 Km/h (25-35 MPH).

ACTION:

Reprogram the powertrain control module (PCM) to the latest calibration using IDS release 96.04 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com.

NOTE: ADVISE THE CUSTOMER THAT THIS VEHICLE IS EQUIPPED WITH AN ADAPTIVE TRANSMISSION SHIFT STRATEGY WHICH ALLOWS THE VEHICLE'S COMPUTER TO LEARN THE TRANSMISSION'S UNIQUE PARAMETERS AND IMPROVE SHIFT QUALITY. WHEN THE ADAPTIVE STRATEGY IS RESET, THE COMPUTER WILL BEGIN A RE-LEARNING PROCESS. THIS RE-LEARNING PROCESS MAY RESULT IN FIRMER THAN NORMAL UPSHIFTS AND DOWNSHIFTS FOR SEVERAL DAYS.

OPERATION	DESCRIPTION	TIME
150142A	2015 F-150 Reprogram The PCM (Do Not Use With Any Other Labor Operations)	0.3 Hr.

WARRANTY STATUS

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage.

Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

DEALER CODING

BASIC PART NO.	CONDITION CODE
RECAL	04

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.

Copyright © 2015 Ford Motor Company