

3.5L GTDI - MALFUNCTION INDICATOR LAMP (MIL) ILLUMINATED WITH DTC P25B0 - BUILT ON OR BEFORE 3/6/2015**TSB 15-0040****FORD:**

2015 F-150

ISSUE

Some 2015 F-150 vehicles equipped with 3.5L Gasoline Turbocharged Direct Injected (GTDI) engines built on or before 3/6/2015 may exhibit diagnostic trouble code (DTC) P25B0 stored in powertrain control module (PCM) memory.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Connect the Ford Integrated Diagnostic System (IDS) service tool or equivalent to the data link connector (DLC) and check for DTCs. Is DTC P25B0 stored in PCM memory?
 - a. No - this article does not apply. Refer to Powertrain Control/Emissions Diagnosis (PC/ED) manual for normal diagnostics.
 - b. Yes - proceed to Step 2.
2. Reprogram the powertrain control module (PCM) to the latest calibration using IDS release 94.04 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com.

OPERATION	DESCRIPTION	TIME
150040A	2015 F-150 3.5L GTDI: Retrieve DTCs And Reprogram The PCM (Do Not Use With Any Other Labor Operations)	0.3 Hr.

WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

DEALER CODING

BASIC PART NO.	CONDITION CODE
RECALEM	04

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.