

**ELECTRONIC PARKING BRAKE - PARKING BRAKE MALFUNCTION  
MESSAGE IN THE MESSAGE CENTER WITH DTC U3000 – BUILT ON OR  
BEFORE 2/21/2015**

**TSB 15-0102**

**FORD:**

2015 F-150

**ISSUE**

Some 2015 F-150 vehicles equipped with an electronic park brake (EPB) and built on or before 2/21/2015 may exhibit a parking brake malfunction message displayed in the message center, a yellow park brake indicator illuminated and the red brake warning indicator flashing when activating the park brake with diagnostic trouble code (DTC) U3000:49 stored in the EPB module.

**ACTION**

Follow the Service Procedure steps to correct the condition.

**SERVICE PROCEDURE**

1. Connect the Ford Integrated Diagnostic System (IDS) service tool or equivalent scan tool to the data link connector (DLC). Is DTC U3000:49 stored in the EPB module with any other DTCs?
  - a. Yes - the module has more than one DTC code. Diagnose all other DTCs prior to performing this procedure. Refer to the Workshop Manual (WSM), Section 206-05 for normal diagnosis.
  - b. No - proceed to step 2.
2. Is DTC U3000:49 stored in the EPB Module?
  - a. Yes - replace the EPB module. Refer to Workshop Manual (WSM), Section 206-05.
  - b. No - this article does not apply. Refer to WSM, Section 206-05 for normal diagnosis.

PART NUMBER	PART NAME
FL3Z-2C496-B	Electronic Park Brake Module

OPERATION	DESCRIPTION	TIME
150102A	2015 F-150: Retrieve DTCs And Replace The EPB Module (Do Not Use With Any Other Labor Operations)	0.3 Hr.

**WARRANTY STATUS:**

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

**DEALER CODING**

BASIC PART NO.	CONDITION CODE
2C496	42

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.