

FORD:

2015 Edge, F-150

ISSUE

Some 2015 F-150 and Edge vehicles equipped with a 2.7L gasoline turbocharged direct injected (GTDI) engine and built on or before 7/1/2015 may exhibit an engine oil leak. This may be due to the engine oil pressure (EOP) sensor threads leaking.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Inspect the EOP sensor. Does the EOP sensor exhibit an oil leak at the sensor threads?
 - a. Yes - proceed to Step 2.
 - b. No - this article does not apply. Refer to Workshop Manual (WSM), Section 303-00.
2. Remove and reseal the EOP sensor, refer to WSM, Section 303-14. Clean the area as necessary.
3. Check the oil level. Refer to WSM, Section 303-01.

PART NUMBER	PART NAME
TA-24-B	Motorcraft® Thread Sealant with PTFE
PM-4-A	Motorcraft® Metal Brake Parts Cleaner
XO-5W30-QSP	Motorcraft® SAE 5W-30 Premium Synthetic Blend Motor Oil

OPERATION	DESCRIPTION	TIME
150183A	2015 F-150 2.7L GTDI: Inspect And Reseal EOP Sensor (Do Not Use With Any Other Labor Operations)	0.7 Hr.
150183A	2015 Edge 2.7L GTDI: Inspect And Reseal EOP Sensor (Do Not Use With Any Other Labor Operations)	1.5 Hrs.

WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

DEALER CODING

BASIC PART NO.	CONDITION CODE
9278	D8

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.