



## TECHNICAL SERVICE BULLETIN

### 3.3L/3.5L Duratec/3.5L EcoBoost/5.0L - With Block Heater - Lack Of Heat When Operating In Temperatures Below -20°C (4°F)

**18-  
2250**  
20 August  
2018

This bulletin supersedes 17-2133. Reason for update: New Part/Procedure For Same Condition

#### Model:

<b>Ford</b> 2015-2018 F-150
--------------------------------

#### Summary

This article supersedes TSB 17-2133 to update the Service Procedure and Part List.

**Issue:** Some 2015-2018 F-150 vehicles equipped with a 3.3L/3.5L Duratec, 3.5L EcoBoost and 5.0L engine and equipped with a block heater may exhibit a lack of heat concern from the heating ventilation and air conditioning (HVAC) system when operating the vehicle consistently in temperatures that are below -20°C (4°F). This condition may be due to deposits from the engine coolant becoming trapped in the heater core.

**Action:** Follow the Service Procedure steps to correct the condition.

#### Parts

Part Number	Description	Quantity
CV6Z-6A051-C	Immersion Block Heater - 3.3L, 3.5L, and 5.0L	1
FL3Z-6B018-F	Block Heater Harness - 5.0L	1
HL3Z-6B018-B	Block Heater Harness - 3.5L Duratec	1
JL3Z-6B018-A	Block Heater Harness - 3.3L Duratec	1
HL3Z-6B018-A	Block Heater Harness - 3.5L EcoBoost	1
FL3Z-6B018-A	Block Heater Harness - 3.5L EcoBoost (Raptor)	1
6E5Z-19E889-D	Thermostatic Expansion Valve Manifold O-ring	1
6E5Z-19E889-E	Thermostatic Expansion Valve Manifold O-ring	1
HL3Z-8255-A	Thermostat O-ring Seal - 3.5L EcoBoost	1
BR3Z-8255-A	Thermostat O-ring Seal - 5.0L, 3.3L/3.5L Duratec	1
N808684-S101	Steering Shaft Bolt	1
FL3Z-18476-B	Heater Core	1
BC3Z-8287-C	Heater Core Line Clips	1
W718633-S451	Front Seat Bolt	8
FPS 8262	Authorized Modification Label	1
VC-1	Motorcraft® Premium Cooling System Flush	1
VC-13-G	Motorcraft® Yellow Concentrated Antifreeze/Coolant	2
YN-35	Motorcraft® R-1234yf Refrigerant PAG Oil (2017-2018 F-150)	1
YN-12-D	Motorcraft® PAG Refrigerant Compressor Oil (2015-2016 F-150)	1

**Warranty Status:** Eligible Under Provisions Of New Vehicle Limited Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

### Labor Times

Description	Operation No.	Time
2015-2017 F-150 3.5L Duratec, 2015-2018 F150 3.5L GTDI, 2018 F150 3.3L 40/40 Seat: Test Heater Core Temperature, Flush Cooling System And Replace The Heater Core Includes Time To Inspect And Replace Block Heater If Necessary (Do Not Use With Any Other Labor Operations Outside Of This Article)	182250A	7.7 Hrs.
2015-2017 F-150 3.5L Duratec, 2015-2018 F150 3.5L GTDI, 2018 F150 3.3L 40/20/40 Seat: Test Heater Core Temperature, Flush Cooling System And Replace The Heater Core Includes Time To Inspect And Replace Block Heater If Necessary (Do Not Use With Any Other Labor Operations Outside Of This Article)	182250B	8.2 Hrs.
2015-2017 F-150 3.5L Duratec, 2015-2018 F150 3.5L GTDI, 2018 F150 3.3L Floor Shift: Test Heater Core Temperature, Flush Cooling System And Replace The Heater Core Includes Time To Inspect And Replace Block Heater If Necessary (Do Not Use With Any Other Labor Operations Outside Of This Article)	182250C	8.5 Hrs.
2015-2017 F-150 3.5L Duratec, 2015-2018 F150 3.5L GTDI, 2018 F150 3.3L Console: Test Heater Core Temperature, Flush Cooling System And Replace The Heater Core Includes Time To Inspect And Replace Block Heater If Necessary (Do Not Use With Any Other Labor Operations Outside Of This Article)	182250D	8.2 Hrs.
2015-2018 F-150 5.0L 40/40 Seat: Test Heater Core Temperature, Flush Cooling System And Replace The Heater Core Includes Time To Inspect And Replace Block Heater If Necessary (Do Not Use With Any Other Labor Operations Outside Of This Article)	182250E	8.8 Hrs.
2015-2018 F-150 5.0L 40/20/40 Seat: Test Heater Core Temperature, Flush Cooling System And Replace The Heater Core Includes Time To Inspect And Replace Block Heater If Necessary (Do Not Use With Any Other Labor Operations Outside Of This Article) (Do Not Use With Any Other Labor Operations Outside Of This Article)	182250F	9.1 Hrs.
2015-2018 F-150 5.0L Floor Shift: Test Heater Core Temperature, Flush Cooling System And Replace The Heater Core Includes Time To Inspect And Replace Block Heater If Necessary (Do Not Use With Any Other Labor Operations Outside Of This Article)	182250G	9.4 Hrs.
2015-2018 F-150 5.0L Console: Test Heater Core Temperature, Flush Cooling System And Replace The Heater Core Includes Time To Inspect And Replace Block Heater If Necessary (Do Not Use With Any Other Labor Operations Outside Of This Article)	182250H	9.2 Hrs.
2015-2018 F-150: Additional Time To Replace The Block Heater Wire Harness (Can Be Claimed With Labor Operations A - H)	182250J	0.2 Hrs.
Additional Time To Remove And Install Police Equipment That Interferes With Repair (Can Be Claimed With Labor Operations A - H)	MT182250	Actual Time

### Repair/Claim Coding

Causal Part:	18472
Condition Code:	49

### Service Procedure

- 1.** Does the vehicle exhibit a lack of heat from the vents when operated in temperatures consistently below -20°C (4°F) and is it equipped with a block heater?
  - (1). Yes - proceed to Step 2.
  - (2). No - this article does not apply. Refer to Workshop Manual (WSM), Section 412-00 for normal diagnostics.
- 2.** Run the engine until it reaches normal operating temperature. Select the floor position on the control assembly. Set the temperature control to full warm and the blower to medium setting.
- 3.** Increase the engine speed to 3,500 revolutions per minute (RPM). After 30 seconds, allow the engine to return to idle for an additional 30 seconds.
- 4.** Using a suitable temperature measuring device, measure the heater core inlet hose temperature. Is the heater core inlet hose temperature above 66°C (150°F)?
  - (1). Yes - proceed to Step 5.
  - (2). No - this article does not apply. Refer to WSM, Section 412-00 for normal diagnostics.
- 5.** Measure the heater core inlet and outlet hose temperature. Are the hose temperatures within 6-17°C (10-30°F)?
  - (1). Yes - this article does not apply. Refer to WSM, Section 412-00.
  - (2). No - proceed to Step 6.
- 6.** Drain the cooling system. Refer to WSM, Section 303-03.
- 7.** On vehicle equipped with the 5.0L engine, remove the coolant hoses from the transmission fluid warmer. Refer to WSM, Section 307-02.
- 8.** Remove the thermostat. Refer to WSM, Section 303-03.
- 9.** Disconnect the lower radiator hose.
- 10.** Using a garden hose, flush the inlet and outlet radiator hoses for 2 minutes each.
- 11.** Reassemble the thermostat housing without the thermostat installed. Do not reconnect radiator hoses to the housing at this time.
- 12.** Using a garden hose, flush the degas bottle for 2 minutes.
- 13.** Close the radiator drain valve.
- 14.** On vehicle equipped with the 5.0L engine, reattach the coolant hoses to the transmission fluid warmer.
- 15.** Disconnect the inlet and outlet heater core hoses from the heater core. Refer to WSM, Section 412-00.
- 16.** Using a garden hose, flush the inlet and outlet heater hoses back toward the engine for 5 minutes each.
- 17.** Reattach all hoses except for the inlet and outlet heater hoses.
- 18.** Using pinch pliers, clamp off the inlet and outlet heater hoses.
- 19.** Add 1 bottle of Motorcraft® Premium Cooling System Flush and fill the rest of the cooling system with water.
- 20.** Connect the appropriate Ford diagnostic scan tool to the vehicle and start the engine.
- 21.** Allow the engine to reach normal operating temperature.
- 22.** Run the engine at 2,500 RPM for 15 minutes with the climate control system off.
- 23.** Return the engine to idle. Using the appropriate Ford diagnostic scan tool, command the cooling fans on high speed for 5 minutes.
- 24.** Turn the engine off and open the degas bottle cap carefully as the water could be hot. Refer to WSM, Section 303-03.

25. Drain the cooling system. Refer to WSM, Section 303-03.
26. On vehicle equipped with the 5.0L engine, remove the coolant hoses from the transmission fluid warmer.
27. Using a garden hose, flush the degas bottle at the cap opening for 2 minutes.
28. Close the radiator drain valve.
29. On vehicle equipped with the 5.0L engine, reattach the coolant hoses to the transmission fluid warmer.
30. Fill the cooling system with water. Refer to WSM, Section 303-03.
31. Repeat Steps 20 through 27.
32. Remove the pinch pliers from the inlet and outlet heater core hoses and backflush toward the engine with a garden hose for 1 minute each.
33. On vehicle equipped with the 5.0L engine, use a garden hose and flush the transmission fluid warmer coolant inlet and outlet with water for 1 minute each.
34. Using a garden hose, flush the degas bottle with water for 2 minutes.
35. If equipped, disconnect the coolant hoses from the engine oil cooler and flush the inlet and outlet ports of the cooler with water for 1 minute each. Reconnect hoses. Refer to WSM, Section 303-01.
36. Remove the block heater and allow the block to drain. Refer to WSM, Section 303-03.
37. Install the thermostat. Refer to WSM, Section 303-03.
38. Inspect the block heater. If the block heater is stainless steel (part number on part is CV6T-6A051-AA or HL3T-6A051-AB), reinstall the block heater. If the original block heater is brass (part number on part is 94BB-6A051-AA), install a new revised block heater.
39. Remove the block heater wire harness and install the new block heater wire harness following the same routing.
40. On vehicle equipped with the 5.0L engine, reconnect the coolant hoses to the transmission fluid warmer.
41. Replace the heater core. Clean the heater core inlet and outlet metal tubes with hot water until free of deposits. Refer to WSM, Section 412-00.
42. Fill the cooling system. Refer to WSM, Section 303-03 to determine correct coolant concentration based on the climate.
43. Fill out FPS-8262 Authorized Modification Label with the following text: "Use Only Motorcraft® VC-13-G Yellow Coolant"
44. Clean the coolant reservoir surface with isopropyl alcohol or equivalent and apply the Authorized Modification Label.
45. Advise the owner or driver that the unit is using a different coolant (Motorcraft® VC-13-G Yellow Coolant) for the environmental conditions. Highlight the coolant used on the customer's copy of the repair order.

---

© 2018 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.