



TECHNICAL SERVICE BULLETIN

2.7L EcoBoost - Illuminated Malfunction Indicator Lamp (MIL) With Diagnostic Trouble Code (DTC) P0471

18-2324
23 October
2018

Model:

Ford 2018 F-150

Issue: Some 2018 F-150 vehicles equipped with a 2.7L EcoBoost engine may exhibit an illuminated MIL with DTC P0471 stored in the powertrain control module (PCM).

Action: Follow the Service Procedure steps to correct the condition.

Parts

Part Number	Description	Quantity
JT4Z-9J460-A	Exhaust Pressure Sensor	1

Warranty Status: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2018 F-150 2.7L EcoBoost: Retrieve DTCs And Replace The Exhaust Pressure Sensor (Do Not Use With Any Other Labor Operations)	182324A	0.3 Hrs.

Repair/Claim Coding

Causal Part:	9J460
Condition Code:	42

Tool List

Drive	Tool Name
1/4"	Power Tool
1/4"	Ratchet
1/4"	Torque Wrench
1/4"	7 mm Socket
3/8"	Ratchet
3/8"	Torque Wrench
3/8"	6" Extension
3/8"	24 mm Socket

Service Procedure

1. Connect the appropriate Ford scan tool or equivalent scan tool and check for DTCs. Is DTC P0471 the only DTC stored in the PCM?
 - (1). Yes - proceed to Step 2.
 - (2). No - this article does not apply. Refer to the Powertrain Controls/Emissions Diagnosis (PC/ED) Manual for normal diagnostics.
2. Replace the exhaust pressure sensor. Refer to Workshop Manual (WSM), Section 303-14A.

© 2018 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.