


<b>Connector:</b> <b>C9039</b>	<b>Description</b> AUTO-DIMMING INTERIOR MIRROR	<b>Color</b> BK	<b>Harness</b> 14358	<b>Base Part #</b> 17700	<b>Service Pigtail</b> Not Available
-----------------------------------	--	--------------------	-------------------------	-----------------------------	---

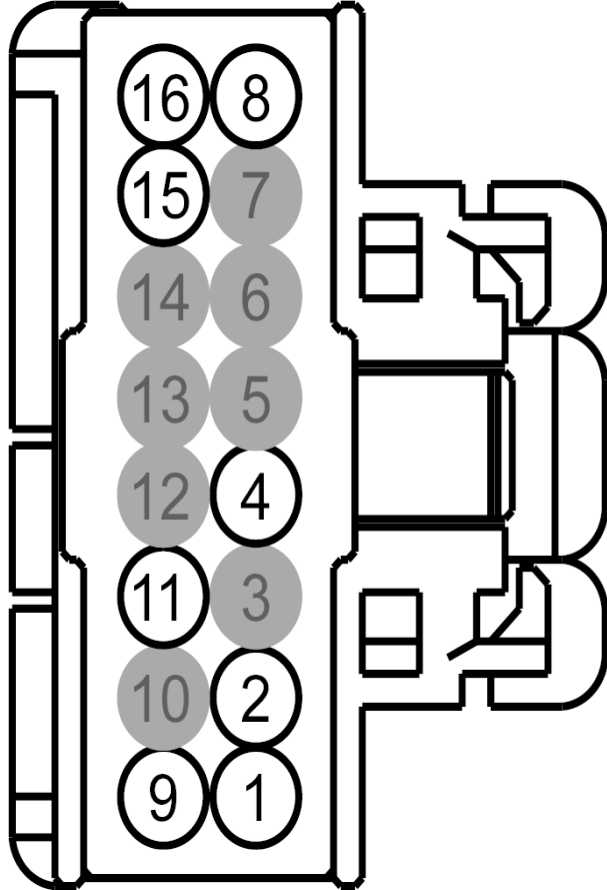

Pin	Circuit	Gauge	Circuit Function	Qualifier
1	CBP32 (GN-VT)	18	FUSE - 32 OR CIRCUIT BREAKER	
2	VDN01 (BU-WH)	20	CTRL MOD. - LIN BUS # SPDJB 1	
3	*	*	Not Used	
4	GD133 (BK)	20	GROUND - COWL SIDE/PILLAR A LEFT (6L2T)	
5	*	*	Not Used	
6	*	*	Not Used	
7	*	*	Not Used	
8	VMP19 (WH-GN)	20	CAMERA - PARKING AID REAR VIDEO	
9	CLS28 (BU-WH)	20	CTRL MOD. - RELAY REVERSE LAMP CONTROL (RLC)	
10	*	*	Not Used	
11	LRD12 (BU-GY)	22	CTRL MOD. - ELECTROCHROMIC MIRROR	
12	*	*	Not Used	
13	*	*	Not Used	
14	*	*	Not Used	
15	RRD12 (BN)	22	CTRL MOD. - ELECTROCHROMIC MIRROR	
16	RMP19 (BN-VT)	20	CAMERA - PARKING AID REAR VIDEO	

**There is not a service pigtail available for this connector. Should one be developed?**

Yes No